


POLYGLASS ROOFING SYSTEM DETAIL

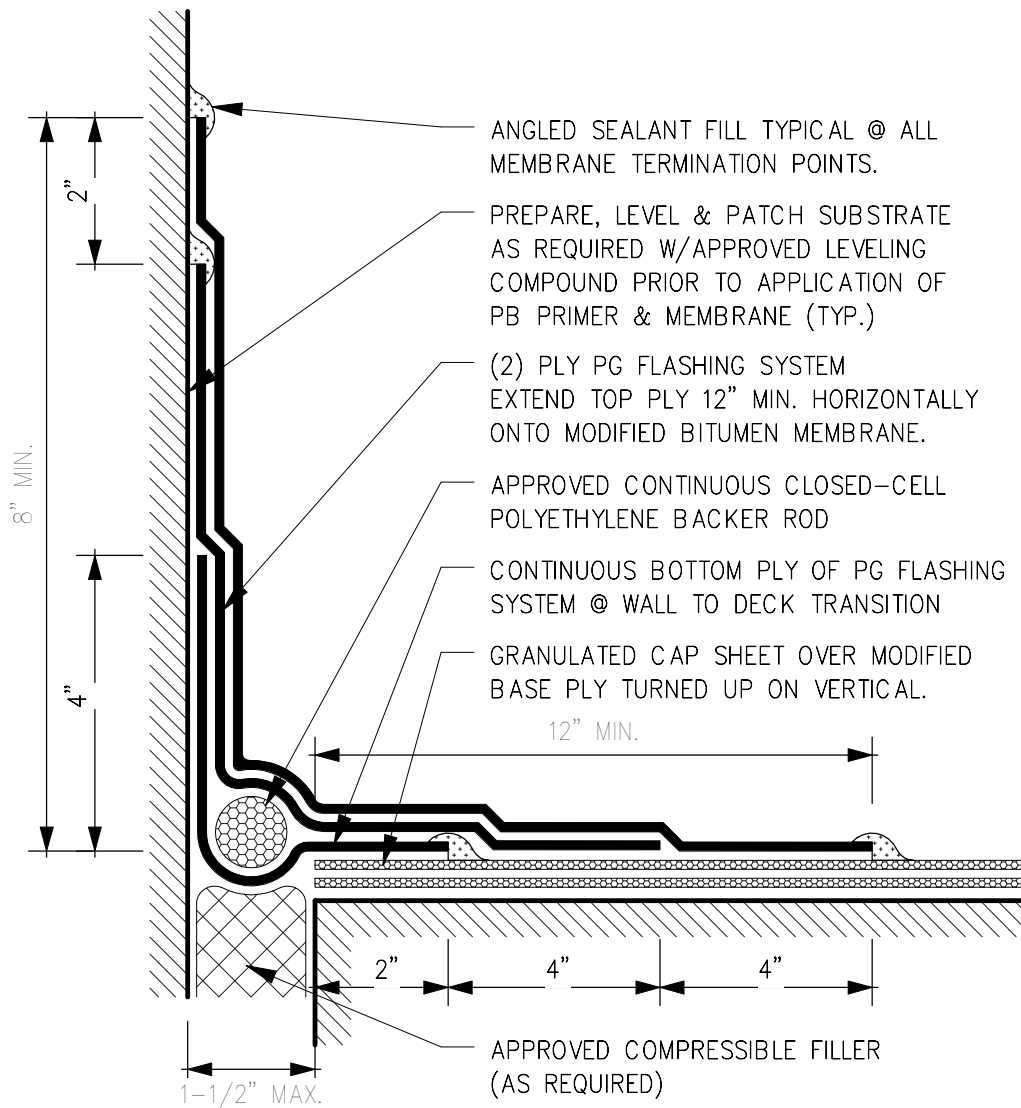

KEYNOTES:

- 1) Cleaning and Preparation – Clean and prepare the surface by brooming, mild detergent & water rinse or as required to remove any conditions that could adversely affect adhesion of primers and liquid materials.
- 2) Surfaces to receive PG Flashing System should be primed with Polyflash Primer 1400. For porous substrates use Polyflash Primer 2500.
- 3) PG Flashing System consists of the following;
 - Polybrite base coat material
 - Polybrite Fleece 165
 - Polybrite surface coat material
- 4) Illustration and notations intended for generalized applications only. Please refer to Product Data Sheets for additional information.
- 5) Urethane sealant for terminations shall be compliant with ASTM C920.

HORIZONTAL TO VERTICAL
TRANSITION EXPANSION JOINT
FLASHING

NUMBER:

PG-LF-EXJOINT-01

DATE:

MARCH 2016



www.polyglass.com